

AIRFRAME MAINTENANCE RECORDS

			Log No
Airc	raft Registration No	N 616 AR	A
Aircraft Mfg. Ppev	Model <u>PA32</u>	R-301T	Serial No. <u>3257 423</u>
Engine Mfg	Model		Serial No
Engine Mfg	Model		Serial No
Propeller Mfg	Model		Serial No
Hub Design No		Hub Serial No	
Blade Design No.		Blade Serial N	lo's
		*	
Propeller Mfg	Model		_ Serial No
Hub Design No.		Hub Serial No	•
Blade Design No		Blade Serial N	o's
	•		

(All applicable information must be filled in)



AFROTECH PUBLICATIONS INC.

www.adlog.com P.O. Box 1359 / Southold, NY 11971-0965 (631) 765-9375 1-800-235-6444

FAX: (631) 765-9359

DATE	TOTAL TIME IN SERVICE	TACH OR RECORDING METER TIME	N616AR TACH: 727.8 TTAF: 727.8 DATE: 14 FEB. 2014	; WORK
		TOTAL br	SERVICED NOSE STRUT WITH NITROGEN. ADJUSTED NOSE GEAR UP SWITCH.	
ρ			FOR SPIDERS AIRCRAFT SERVICE, INC. SAN DIEGO, CA	
			N616AR TACH: 728.0 TTAF: 728.0 DATE: 21 MAR. 2014	```
			SERVICED BATTERY, CLEANED FUEL STRAINER SCREEN & BOWL. LUBED & INSPECTED FLIGHT CONTROL HINGES, PULLEYS, FLAP MECH. & STABILATOR ASSY.	ager old
			INSTALLED CHAFE TAPE IN FLAP WELLS. REMOVED OXYGEN BOTTLE FOR € HYDROSTATIC TEST BY OUTSIDE SERVICE. REINSTALLED OXYGEN BOTTLE AND REFILLED WITH OXYGEN FROM OUTSIDE SERVICE.	2222
			I CERTIFY THAT THIS <u>AIRCRAFT</u> HAS BEEN INSPECTED IN ACCORDANCE WITH AN <u>ANNUAL INSPECTION</u> , AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.	46
			7 AECSTOPHOSOLA	
			SPIDERS AIRCRAFT SERVICE, INC. SAN DIEGO, CA	
			N616AR TACH: 728.0 DATE: 21 MAR. 2014	
			PERFORMED FUNCTIONAL TEST OF ELT AS PER FAR 91.207(D) FOUND SATISFACTORY AT THIS TIME. NEXT TEST DUE JAN. 2018	
		`		
			7 De Atistomoso IA	
			SPIDERS AIRCRAFT SERVICE, INC. SAN DIEGO, CA	
		- - -	Advanced Aircraft Service 8622 Gibbs Dr. San Diego, CA. 92123 858-560-7599 Fax 858-560-7507	
		-	CESSNA SERVICE CENTER Date: 1/14/15 N#: N616AR S/N: Hobbs: 778,5 hr TT: TTSMOH:	-
			etric standby horizon for recalibration by Instrument Overhaul of 43, Installed new M14-10060 battery pack for standby electric h	
		_ <u></u>	AP3467663 END	
			EMERGENCY BATTERY REPLACEMENT Affix this label in aircraft logbook	
			Recommended battery replacement 3 years from date of manufacture. Order replacement battery from Mid-Continent Instruments and Avionics at (800) 821-1212.	
		SUR-TOTA	Date of Manufacture:	

TOTAL-Carry forward to next page

Page No.

	TOTAL			d Aircraft Service		
			262	2 Gibbs Dr.		
ATE	TIME			ego, CA. 92123		ODK
	SERVICE			9 Fax 858-560-7507		ORK
15.0000000				SERVICE CENTER		
			Date:4/17/15		S/N:3257423	
			Hobbs:794.6 hr		SMOH:	
	0	Installed now	070-317-0 tires on both			
			k filter cleaning and 3			
			G243 S/N G02867305		ob inspections,	
			A inspections, SB1048		A)	
			h ELT inspection and t			
			has been inspected I/			
	1		aft Maintenance Manua			
		Inspection, ar	nd was determined to I	be in an airworthy con	dition at this time.	
	-		00			
			1100	IA3467663		
				END		_
	-				*	
_						
_ [
			Air 88 Inc.	dba CROWNAIR		
_				pair Station #CWNR273	K	
				J. Montgomery Dr.		
_ 1				ego, CA 92123		
				60, 011 71110		
_ 1	N616AR		Piper PA	-32R-301T	S/N:	3257423
1.6	6-12-15					
	Maintenance Removed Garmin f removed 5941692	GNS-430 #1 P/N or WAAS upgrad GA-56 #1 Ante 7. Installed new 0	Hobbs: 8 011-00280-10, S/N 97132 e. Verified coax was RG58 nna P/N 011-00134-00, S GA-35 WAAS Antenna P/	18.7 Hrs 714 and GNS-430 #2 P/N 3 and ran new RG400 coa 5/N 59416967 and GA-5 N 013-00235-00, S/N 106	011-00280-10, S/N 9713 k to both antennas. Gain 6 #2 Antenna P/N 01 731 and P/N 013-00235	ned access to and 1-00134-00, S/N 5-00, S/N 113626
	Maintenance Removed Garmin fremoved 5941692' respective 9713284' Installatio guideline was inser- Removed Received reinstallet test per Ir Complete Certify that vegulations. (1)	GNS-430 #1 P/N or WAAS upgrad GA-56 #1 Ante 7. Installed new 6 back from Garn on Manual 190-0 s specified in STC ted into POH. No existing GTX-3 GTX-330ES Trd per Garmin GTX astallation Manual 6d FAA Form 337. with respect to the Only those items	Hobbs: 8 011-00280-10, S/N 97132 e. Verified coax was RG58 nna P/N 011-00134-00, S GA-35 WAAS Antenna P/N odified GNS-430W P/N 01 nin after WAAS upgrade a 0357-06 Rev. E, dated Ja 2 #SA01933LA-D issued Ja defects noted. 30 Transponder P/N 011- ansponder P/N 011-00455 K-ES Series STC SA01714 P/N 190-00734-10 dated A	18.7 Hrs 714 and GNS-430 #2 P/N 8 and ran new RG400 coars (N 59416967 and GA-50 N 013-00235-00, S/N 1060 1-01060-40, S/N 9713271 and installed in aircraft. (Inuary 2014. All above ally 31, 2009. AFMS 190-60, S/N 84121241 5-60, S/N 84121241 back (WI dated May 1, 2013. Papril 2013 Rev. 2. AFMS or have been inspected and installed was repaired and installed was repaired and installed the second of the second	011-00280-10, S/N 9713 to both antennas. Gain 6 #2 Antenna P/N 01731 and P/N 013-00235 4 and modified P/N 01 Configured and tested procedures were carried 00357-03 Rev. D dated and sent to Garmin after Performed configuration updated as required. No spected in accordance will found to be airworthy	ned access to and 1-00134-00, S/N 5-00, S/N 113626 1-01060-40, S/N oer STC Upgrade and out under the January 28, 2014 for ES upgrade and final ground defects noted.
	Maintenance Removed Garmin fremoved 5941692' respective 9713284' Installatio guideline was inser- Removed Received reinstallet test per Ir Complete Certify that vegulations. (1)	GNS-430 #1 P/N or WAAS upgrad GA-56 #1 Ante 7. Installed new 6 back from Garn on Manual 190-0 s specified in STC ted into POH. No existing GTX-3 GTX-330ES Trd per Garmin GTX astallation Manual 6d FAA Form 337. with respect to the Only those items	Hobbs: 8 011-00280-10, S/N 97132 e. Verified coax was RG58 nna P/N 011-00134-00, S GA-35 WAAS Antenna P/N odified GNS-430W P/N 01 nin after WAAS upgrade a 0357-06 Rev. E, dated Ja 2 #SA01933LA-D issued Ja defects noted. 30 Transponder P/N 011- ansponder P/N 011-00455 K-ES Series STC SA01714 P/N 190-00734-10 dated A e work performed this airc specified in the work orde	18.7 Hrs 714 and GNS-430 #2 P/N 8 and ran new RG400 coars (N 59416967 and GA-50 N 013-00235-00, S/N 1060 1-01060-40, S/N 9713271 and installed in aircraft. (Inuary 2014. All above ally 31, 2009. AFMS 190-60, S/N 84121241 5-60, S/N 84121241 back (WI dated May 1, 2013. Papril 2013 Rev. 2. AFMS or have been inspected and installed was repaired and installed was repaired and installed the second of the second	011-00280-10, S/N 9713 to both antennas. Gain 6 #2 Antenna P/N 01731 and P/N 013-00235 4 and modified P/N 01 Configured and tested procedures were carried 00357-03 Rev. D dated and sent to Garmin after Performed configuration updated as required. No spected in accordance with found to be airworthy 0. AV-15-02605.	ned access to and 1-00134-00, S/N 5-00, S/N 113626 1-01060-40, S/N oer STC Upgrade and out under the January 28, 2014 for ES upgrade and final ground defects noted.
	Maintenance Removed Garmin fremoved 5941692' respective 9713284' Installatio guideline was inser- Removed Received reinstallet test per Ir Complete Certify that vegulations. (1)	GNS-430 #1 P/N or WAAS upgrad GA-56 #1 Ante 7. Installed new 6 back from Garn on Manual 190-0 s specified in STC ted into POH. No existing GTX-3 GTX-330ES Trd per Garmin GTX astallation Manual 6d FAA Form 337. with respect to the Only those items	Hobbs: 8 011-00280-10, S/N 97132 e. Verified coax was RG58 nna P/N 011-00134-00, S GA-35 WAAS Antenna P/N odified GNS-430W P/N 01 nin after WAAS upgrade a 0357-06 Rev. E, dated Ja 2 #SA01933LA-D issued Ja defects noted. 30 Transponder P/N 011- ansponder P/N 011-00455 K-ES Series STC SA01714 P/N 190-00734-10 dated A e work performed this airc specified in the work orde	18.7 Hrs 714 and GNS-430 #2 P/N 8 and ran new RG400 coars (N 59416967 and GA-50 N 013-00235-00, S/N 1060 1-01060-40, S/N 9713271 and installed in aircraft. (Inuary 2014. All above ally 31, 2009. AFMS 190-60, S/N 84121241 5-60, S/N 84121241 back (WI dated May 1, 2013. Papril 2013 Rev. 2. AFMS or have been inspected and installed was repaired and installed was repaired and installed the second of the second	011-00280-10, S/N 9713 to both antennas. Gain 6 #2 Antenna P/N 01731 and P/N 013-00235 4 and modified P/N 01 Configured and tested procedures were carried 00357-03 Rev. D dated and sent to Garmin after Performed configuration updated as required. No spected in accordance with found to be airworthy 0. AV-15-02605.	ned access to and 1-00134-00, S/N 5-00, S/N 113626 1-01060-40, S/N oer STC Upgrade and under the January 28, 2014 for ES upgrade and and final ground defects noted.
	Maintenance Removed Garmin fremoved 5941692' respective 9713284' Installatio guideline was inser- Removed Received reinstallet test per Ir Complete Certify that vegulations. (1)	GNS-430 #1 P/N or WAAS upgrad GA-56 #1 Ante 7. Installed new 6 back from Garn on Manual 190-0 s specified in STC ted into POH. No existing GTX-3 GTX-330ES Trd per Garmin GTX astallation Manual 6d FAA Form 337. with respect to the Only those items	Hobbs: 8 011-00280-10, S/N 97132 e. Verified coax was RG58 nna P/N 011-00134-00, S GA-35 WAAS Antenna P/N odified GNS-430W P/N 01 nin after WAAS upgrade a 0357-06 Rev. E, dated Ja 2 #SA01933LA-D issued Ja defects noted. 30 Transponder P/N 011- ansponder P/N 011-00455 K-ES Series STC SA01714 P/N 190-00734-10 dated A e work performed this airc specified in the work orde	18.7 Hrs 714 and GNS-430 #2 P/N 8 and ran new RG400 coars (N 59416967 and GA-50 N 013-00235-00, S/N 1060 1-01060-40, S/N 9713271 and installed in aircraft. (Inuary 2014. All above ally 31, 2009. AFMS 190-60, S/N 84121241 5-60, S/N 84121241 back (WI dated May 1, 2013. Papril 2013 Rev. 2. AFMS or have been inspected and installed was repaired and installed was repaired and installed the second of the second	011-00280-10, S/N 9713 to both antennas. Gain 6 #2 Antenna P/N 01731 and P/N 013-00235 4 and modified P/N 01 Configured and tested procedures were carried 00357-03 Rev. D dated and sent to Garmin after Performed configuration updated as required. No spected in accordance with found to be airworthy 0. AV-15-02605.	ned access to and 1-00134-00, S/N 5-00, S/N 113626 1-01060-40, S/N oer STC Upgrade and out under the January 28, 2014 for ES upgrade and final ground defects noted.

TOTAL-Carry forward to next page

D Advanced Aircraft Service 8622 Gibbs Dr. San Diego, CA. 92123 858-560-7599 Fax 858-560-7507 CESSNA SERVICE CENTER

Date: 3/20/2017

N#:616AR

Hobbs: 930.1

Replaced right main tire with new Michelin Air 600X6X8 tire P/N 070-317-0. Cleaned and greased wheel bearings.

Guy La Plante

A&P 3892552

Advanced Aircraft Service 8622 Gibbs Dr. San Diego, CA. 92123 858-560-7599 Fax 858-560-7507 **CESSNA & BEECHCRAFT SERVICE CENTER**

Date: 7/21/2017

N# 616AR

S/N: 3257423

Tach/Hobbs: 942.8

TTAF: 942.8

Serviced aircraft for an annual inspection. Replaced compass light bulb with bulb P/N 327. Applied thread sealant to landing gear emergency extension valve fittings.

C/W SB 1216 B Aileron inspection IAW Par II and IV, next due Hobbs 1042.8

Guy LaPlante

Advanced Aircraft Service 8622 Gibbs Dr. San Diego, CA. 92123 858-560-7599 Fax 858-560-7507 **CESSNA & BEECHCRAFT SERVICE CENTER**

Date: 7/21/2017

N# 616AR

S/N: 3257423

Tach/Hobbs: 942.8

TTAF: 942.8

I certify that the ELT was inspected in accordance with the requirements of FAR 91.207(d), and has been found to be in airworthy condition at this time.

ELT expires 12/18

Guy LaPlante

A&P 3892552

Advanced Aircraft Service 8622 Gibbs Dr. San Diego, CA. 92123

858-560-7599 Fax 858-560-7507 CESSNA / BEECHCRAFT SERVICE CENTER

Date:7/21/17

S/N:3257423

Hobbs:942.8 hr TT:942.8 hr

N#:N616AR

TTSMOH:

This Aircraft has been inspected I/A/W FAR Part 43 Appendix D. using Current Aircraft Maintenance Manual as a guide to complete an Annual Inspection, and was determined to be in an airworthy condition at this time.

IA3467663

END

DATE	Ad	vanced Aircraft 8622 Gibbs I		
See A. Si		San Diego, CA.		_
		60-7599 Fax 85		
		SNA SERVICE		_
Da	ate: 12/13/17	N#: 616AR	Tach/Hobbs: 953.4	
			9:	-
Replaced 1 ter	minal end on #6	CHT probe wire	and cleaned both wire connections	
			7	
Cur	/ La Plante	4 Soldi	A&P 3892552	-
	/ La Plante	141/19/90		2
4	4		<u> </u>	
ACR ELECTRONICS. Inc. ARTEX PRODUCTS - CAGE Code: 18560		Adv	anced Aircraft Service	_
Fort Lauderdale, FL 33312		e	8622 Gibbs Dr. an Diego, CA. 92123	
PART NO: 452-6499 REV: F			0-7599 Fax 858-560-7507	
TSO C126 S.N.:377463-038			ECHCRAFT SERVICE CENTER	_
EXPIRATION DATE: JUN /2025 DO-227	ı	Date:8/10/18	N# :N616AR S/N:3257423	
ENV CAT D1XBC[204][204]XRXXXXXZZZZZZZZ]H[XXXX]XXX		Hobbs:1001.5 hr	TT:1001.5 hr TTSMOH:	
			908-01 per 3 yr requirement,	
			passed at 90%,	
	Installed new	ELT battery 455	-0012	
			ection and test, battery is due again 06/25	
			ed I/A/W FAR Part 43 Appendix D. using	
			Manual as a guide to complete an Annual	
	inspection, ar	d was determine	ed to be in an airworthy condition at this time	e
	(1201	IA3467663	
×	~	e ai	END	
	<u>.</u>			
EMERGENCY BATTE		NT		
Affix this label in a				
Recommended battery replacer of manufacture. Order replace	cement battery from			
Mid-Continent Instruments and Av		212.		
Date of Manufacture: 4	17018			
	A	ced Aircraft Se		
		8622 Gibbs Dr.	vice	
		Diego, CA. 921	23	
		7599 Fax 858-56		-
С	ESSNA & BEE	CHCRAFT SER	VICE CENTER	
				_
	te: 3/21/19	N#:616AR	Tach: 1004.8	
s/N	N: 3257423		TTAF:1004.8	
0		notice to the		
			c trim switch P/N 766-775. Replaced fuel	
			olts per Piper PA32R-301T service manual	
			pottle and regulator with overhauled bottle	
and requiator assembly P/	IN 090-24000, S	CE FAA IUIIII O I	30-3 dated 15 Mar 2019. P/N. Replaced	_
			/N 41001037. Replaced stand by attitude	

C/W SB 1216B Aileron Nose Ribs IAW Part I, II and IV, next due Tach 1504.8
C/W S.B. 1244 C Wing Attach Fittings Inspection by borescope inspection of fittings, next due tach 3004.8 or March 2026.

Guy La Plante

Mathat

A&P 3892552

International AeroTech Academy For Training Purposes Only

Advanced Aircraft Service 8622 Gibbs Dr. San Diego, CA. 92123 858-560-7599 Fax 858-560-7507 CESSNA & BEECHCRAFT SERVICE CENTER

Date: 3/21/19 S/N: 3257423 N#:616AR

Tach: 1004.8

TTAF:1004.8

I certify that the ELT has been inspected in accordance with the requirements of FAR 91.207(d) and has been found to be in airworthy condition at this time. ELT expires June 2025.

Guy La Plante

May Soft

A&P 3892552

Advanced Aircraft Service 8622 Gibbs Dr. San Diego, CA. 92123 858-560-7599 Fax 858-560-7507

CESSNA / BEECHCRAFT SERVICE CENTER

Date:3/21/19

N#:N616AR

S/N:3257423

Tach: 1004.8 hr

TT:1004.8 hr

C/W SB1092B visual inspection, SB1242 visual inspection
This Aircraft has been inspected I/A/W FAR Part 43 Appendix D. using
Current Aircraft Maintenance Manual as a guide to complete an Annual
Inspection, and was determined to be in an airworthy condition at this time.



IA3467663

-END

Corporate Air Center N616AR PA-32R-310T S/N:3257423 HOBBS:1055.2



15452 – Airport Drive Burlington, WA 98233 Phone (360) 757-7757 Fax (360) 757-1557 Repaired leaking Air conditioning long line, in engine compartment, hose assembly P/N:A285T16810101018. Pressure test on hose good. Routed and secured hose. Nose gear actuator replaced with new, P/N:35797-5, S/N:3612, MFD:11/2018. Serviced fluid and tested ok. All work done I.A.W. Piper 32R M.M. I certify this component is in an Airworthy Condition at this time.

Hobbs Time:1055.2

02/07/2020

Chad Peterson AP3498801

	1410 Jet Stream Drive, Suite 100	A/C Reg: N616AR
APEATION	Henderson, NV 89052 Phone: 702-735-2739	A/C SN:3257423
CRS: 9VNR950B	WO: N616AR-MXP-4301	A/C HOBBS: 1036.6

Removed left main tire P/N: 070-317-0, S/N: 4274S00003. Installed Serviceable tire P/N: 30845, S/N: B3E60319. See serviceable tag dated 5-18-19. Performed satisfactory leak check. All work done in accordance with PA-32R-301T M. M. 32-40-00.

I certify that this Aircraft has been Serviced/Maintained in accordance with PA-32R-301T M/M and the requirements of 14 CFR Part 43 and with respect to the work performed is airworthy. Pertinent details are on file under W/O# 4301.

Francisco Vela:

18 MAR 2019

TOTAL-Carry forward to next page

Corporate Air Center N616AR PA-32R-301T S/N-3257423 Hobbs:1129.7



15452 - Airport Drive Burlington, WA 98233 Phone (360) 757-7757 Fax (360) 757-1557

Airframe TT: 1129.7 Engine TT: 1129.7 Prop TT: 1129.7

I certify that this aircraft has been inspected in accordance with FAR 43 appendix D and referencing PA-32R-301T M/M. All the following work performed IAW PA-32R-301T M/M and Lycoming TIO-540-AH1A O/H manual. Performed all routine servicing as required for this type of inspection. Complied with the following Ads. AD2013-02-13 horizonal Stab control. Complied with IAW par. (g) of AD inspection procedures and IAW piper SB 1245A par. I-10 no discrepancies at this time. AD2017-14-04 oil cooler hose ASSYTSO requirements. Found P/C/W by (d) type hoses installed, AD84-26-02 paper induction air filter installed new filter. AD2017-16-11 connecting rod ASSY integrity, F/N/A affected parts not replaced during affected dates. AD2015-19-07 fuel injector lines complied with IAW Lycoming MSB 342G. Tested ELT IAW FAR 91.207 (d) opps check ok. Cylinder compressions are as follows #1 71 #2 70 #3 71 #4 74 #5 70 #6 74. C/W oil change and sample taken (AOA). Serviced engine with 10QTS of Philips 20/50XC. Installed new oil filter CH48110-1 Inspected filter no medal found.

I certify that This aircraft has been inspected in accordance with a Annual inspection and is approved for return to service pending the following maintenance on the next sign-off.

4-29-2021

Paul Shinn AP35174551A

Paul Sh

Corporate Air Center



Burlington, WA 98233 15452 - Airport Drive Phone (360) 757-7757 Fax (360) 757-1557

Airframe: 1146.3 Hobbs/Tach 1146.3 Engine: 1146.3 Propeller: 1146.3

Bled Brake system Per Piper Maintenance manual 32-40-00

N616AR Model: PA32R-301T S/N: 3257423

7 Serviced breathing oxygen. To 1850 PSI.

1.

James F. Price AP2822851

Date: 5-10-21

Airframe Log

Piper PA-32R-301T Serial#: 3257423 N616AR

Tach Time: September 8, 2021

Removed and replaced alternator with P/N: ES4011-LS. All work performed in accordance with Piper Service manual. Test run and ops check good. Approved for return to service.

Eklin Ehrman A&P 3841044

Corporate Air Center

N616AR PA-32R-301T S/N: 3257423 Hobbs: 1225.1



15452 - Airport Drive Burlington, WA 98233 Phone (360) 757-7757 Fax (360) 757-1557

Airframe TT: 1225.1 Engine SMOH: 1225.1 Prop TSO: 1225.1

C/W an ANNUAL inspection per FAR 43 appendix D and referencing Piper PA-32R-301T Aircraft Maintenance Manual.

- 1. C/W FAR 91.207(d) ELT function test and visual inspection. No defects noted. Battery due 06/2025
- 2. Serviced all MLG olco struts IAW PA-32R-301T AMM ch. 6.
- C/W AD2017-14-04 par (e)(ii). No defects noted.
- 4. C/W AD84-26-02 (a) Installed new filter P/N P151936
- 5. C/W SB 1198B fuel selector O-Ring. Installed new oring.
- 6. Battery capacity check ok, 106%.
- 7. C/W SB 1366 Inspected main wing spar hardware. No defects noted.

I certify that this Aircraft has been inspected in accordance with an ANNUAL inspection and has been determined to be in an airworthy condition.

05/13/2022

