

N4941A

L/H

www.JohnsonPropeller.com

**JOHNSON**

MINTER FIELD AIRPORT

(661) 399-2480



FAA Repair Station

J3PR491J

**PROPELLER SVC.**

211 AVIATION ST. SUITE 104 SHAFTER, CALIFORNIA 93263

# PROPELLER LOGBOOK

USE OF LOGBOOK

Low: 13.9  
High: 16.8

Owner Name \_\_\_\_\_

Address \_\_\_\_\_

Propeller Model 3AF32504-0

Blade Model G-82NEA-5.5

Hub Serial No. 921885

Blade Serial No. 1 MB124

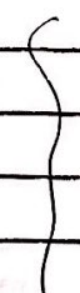
2 MB157

3 MB148

4 \_\_\_\_\_

**INSTALLED DE-ICER BOOTS**  
SMR 2702

# MAINTENANCE & SERVICE HISTORY

Date	Total Propeller Time	Time Since Overhaul	Description of Work	Authorized Signatures Repairman and Station Certificate Numbers
Feb 06 2020		"0"	<b>Propeller completely overhauled</b> IAW <u>MPC 500, BOM 100 rev 9,</u> <u>SPM 100 rev 6</u> <b>Service Manuals</b> All A.D.'s, S/B's, S/L's complied with to date. Pertinent details of this overhaul are on file under W.O. <u>020-037</u> at the following repair facility:	
			<b>Johnson Propeller Ent., Inc.</b> 211 Aviation St. hgr 104 Shafter, CA 93263 861-399-2480 FAA CRS# J3PR491J	

Note: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12

# MAINTENANCE & SERVICE HISTORY

N4941A  
 S/N: 921885  
 MODEL: 3AF32C504-C/G-82NEA-5.5  
 TACH TIME:  
 HOBBS TIME: 464.5



DATE: 2/28/2020  
 W.O.#: 23394  
 TSMOH: 0.0  
 TOTAL TIME:

2980 AIRWAY AVE, COSTA MESA, CA 92626  
 TEL: 714-433-2275, WWW.JAVSAIRCRAFT.COM  
 FAA APPROVED REPAIR STATION # JVVYR016L

## LEFT PROPELLER LOG

THE AIRCRAFT AND / OR COMPONENT IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AVIATION REGULATIONS AND WAS FOUND AIRWORTHY FOR RETURN TO SERVICE. PERTINENT DETAILS OF THE REPAIR / REPLACEMENT ARE ON FILE AT THIS AGENCY  
 SIGNED: *[Signature]*

R&R OF PROPELLER WITH OVERHAULED MCCAULEY PROPELLER P/N 3AF32C504-C/G-82NEA-5.5, S/N 921885 IAW MCCAULEY, CESSNA 310R AND TCM IO-520 SERVICE MANUALS AFTER OVERHAULED BY OUTSIDE VENDOR UNDER INVOICE# 020-037. OPERATIONAL, SECURITY, LEAK, AND FLIGHT TEST FOUND SATISFACTORY.


Note: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12



# MAINTENANCE & SERVICE HISTORY

N4941A  
 S/N: 921885  
 MODEL: 3AF32C504-C/G-82NEA-5.5  
 TACH TIME:  
 HOBBS TIME: 513.2



DATE: 7/20/2020  
 W.O.#: 23735  
 TSMOH: 48.7  
 TOTAL TIME:

2990 AIRWAY AVE. COSTA MESA, CA 92626  
 TEL: 714-453-2275, WWW.JAYS AIRCRAFT.COM  
 FAA APPROVED REPAIR STATION # JVVYR016L

## LEFT PROPELLER LOG

THE AIRCRAFT AND / OR COMPONENT IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AVIATION REGULATIONS AND WAS FOUND AIRWORTHY FOR RETURN TO SERVICE. PERTINENT DETAILS OF THE REPAIR / REPLACEMENT ARE ON FILE AT THIS AGENCY  
 SIGNED: *[Signature]*

C/W ANNUAL INSPECTION IAW CESSNA 310R MAINTENANCE MANUAL.
C/W ANNUAL INSPECTION IAW McCAULEY MAINTENANCE MANUAL.
R&R L/H PROPELLER IAW CESSNA 310R AND TCM IC-520 SERVICE MANUAL AFTER R&R CRANKSHAFT SEAL WITH NEW P/N 641250 AND PROPELLER O-RINGS WITH NEW P/N M83248-1-140. OPERATIONAL AND LEAK CHECK FOUND SATISFACTORY.
REPAIRED L/H AND R/H ENGINE PROPELLER HEAT WIRES IAW AC43.13-1B AS REQUIRED. OPERATIONAL CHECK FOUND SATISFACTORY
SOME SBs THAT APPLY TO THIS AIRCRAFT MAY NOT HAVE BEEN PERFORMED PER OWNER'S DECISION.
C/W ALL APPLICABLE ADs THROUGHOUT THIS DATE.

Note: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12

# MAINTENANCE & SERVICE HISTORY

N4941A  
 S/N: 921885  
 MODEL: 3AF32C504-C/G-82NEA-5.5  
 TACH TIME:  
 HOBBS TIME: 680.7

DATE: 8/11/2021  
 W.O.#: 24338  
 TSMOH: 216.2  
 TOTAL TIME:



2990 AIRWAY AVE. COSTA MESA, CA 92626  
 TEL: 714-433-2275 WWW.JAYS AIRCRAFT.COM  
 FAA APPROVED REPAIR STATION # JYR016L

## LEFT PROPELLER LOG

THE AIRCRAFT AND / OR COMPONENT IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AVIATION REGULATIONS AND WAS FOUND AIRWORTHY FOR RETURN TO SERVICE. PERTINENT DETAILS OF THE REPAIR / REPLACEMENT ARE ON FILE AT THIS AGENCY  
 SIGNED: *[Signature]*

C/W ANNUAL INSPECTION IAW CESSNA 310R MAINTENANCE MANUAL.

C/W ANNUAL INSPECTION IAW McCAULEY MAINTENANCE MANUAL.

SOME SBs THAT APPLY TO THIS AIRCRAFT MAY NOT HAVE BEEN PERFORMED PER OWNER'S DECISION.

C/W ALL APPLICABLE ADs THROUGHOUT THIS DATE.


Note: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12

N4941A

R/H

www.JohnsonPropeller.com

**JOHNSON**

MINTER FIELD AIRPORT

(661) 399-2480

FAA Repair Station

J3PR491J

**PROPELLER SVC.**

211 AVIATION ST. SUITE 104 SHAFTER, CALIFORNIA 93263

# PROPELLER LOGBOOK



USE OF LOGBOOK

Owner Name \_\_\_\_\_

Address \_\_\_\_\_

Low: 13.9

High: 16.8

Propeller Model 3AF32C504-0

Blade Model G-82/NEA-5.5

Hub Serial No. 941050

Blade Serial No. 1 0C011

INSTALLED DE-ICER BOOTS



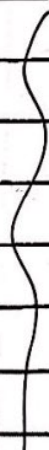
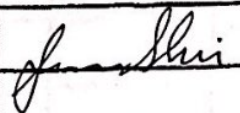
2 0C076

3 0C018

4 -



# MAINTENANCE & SERVICE HISTORY

Date	Total Propeller Time	Time Since Overhaul	Description of Work	Authorized Signatures Repairman and Station Certificate Numbers		
Feb 06 2020		10 <sup>11</sup>	<p><b>Propeller completely overhauled</b>  <b>LAW. MPC 500, BOM 100 rev 9</b>  <b>SPTM 100 rev 6</b> <b>Service Manuals</b>  <b>All A.D.'s, S/B's, S/L's complied with</b>  <b>to date. Pertinent details of this</b>  <b>overhaul are on file under W.O. 020-036</b>  <b>at the following repair facility:</b></p>			
		<p><b>Johnson Propeller Ent., Inc.</b>  <b>211 Aviation St. hgr 104</b>  <b>Shafter, CA 93263</b>  <b>661-399-2480</b>  <b>FAA CRS# J3PR491J</b></p>	<p><b>Juan Salais</b>  <b>3826866</b></p> 			

Note: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12

# MAINTENANCE & SERVICE HISTORY

N4941A  
 S/N: 941050  
 MODEL: 3AF32C504-C/G-82NEA-5.5  
 TACH TIME:  
 HOBBS TIME: 464.5



DATE: 2/28/2020  
 W.O.#: 23394  
 TSMOH: 0.0  
 TOTAL TIME:

2980 AIRWAY AVE. COSTA MESA, CA 92626  
 TEL: 714-433-2275, WWW.JAYS AIRCRAFT.COM  
 FAA APPROVED REPAIR STATION # JVVYR016L

## RIGHT PROPELLER LOG

THE AIRCRAFT AND / OR COMPONENT IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AVIATION REGULATIONS AND WAS FOUND AIRWORTHY FOR RETURN TO SERVICE. PERTINENT DETAILS OF THE REPAIR / REPLACEMENT ARE ON FILE AT THIS AGENCY  
 SIGNED: *[Signature]*

R&R RHP PROPELLER WITH OVERHAULED MCCAULEY PROPELLER P/N 3AF32C504-C/G-82NEA-5.5, S/N 941050 IAW MCCAULEY, CESSNA 310R AND TCM IO-520 SERVICE MANUALS AFTER OVERHAULED BY OUTSIDE VENDOR UNDER INVOICE# 020-036. R&R DE-ICE BRUSH BLOCK WITH NEW P/N RAB40189. OPERATIONAL, SECURITY, LEAK, AND FLIGHT TEST FOUND SATISFACTORY.


Note: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12

# MAINTENANCE & SERVICE HISTORY

N4941A  
 S/N: 941050  
 MODEL: 3AF32C504-C/G-82NEA-5.5  
 TACH TIME:  
 HOBBS TIME: 513.2

DATE: 7/20/2020  
 W.O.#: 23735  
 TSMOH: 48.7  
 TOTAL TIME:



2910 AIRWAY AVE. COSTA MESA, CA 92626  
 TEL: 714-433-2275, WWW.JAYS AIRCRAFT.COM  
 FAA APPROVED REPAIR STATION # JYR016L

## RIGHT PROPELLER LOG

THE AIRCRAFT AND / OR COMPONENT IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AVIATION REGULATIONS AND WAS FOUND AIRWORTHY FOR RETURN TO SERVICE. PERTINENT DETAILS OF THE REPAIR / REPLACEMENT ARE ON FILE AT THIS AGENCY  
 SIGNED: *[Signature]*

C/W ANNUAL INSPECTION IAW CESSNA 310R MAINTENANCE MANUAL.

C/W ANNUAL INSPECTION IAW McCAULEY MAINTENANCE MANUAL.

REPAIRED L/H AND R/H ENGINE PROPELLER HEAT WIRES IAW AC43.13-JB AS REQUIRED. OPERATIONAL CHECK FOUND SATISFACTORY

SOME SBs THAT APPLY TO THIS AIRCRAFT MAY NOT HAVE BEEN PERFORMED PER OWNER'S DECISION.

C/W ALL APPLICABLE ADs THROUGHOUT THIS DATE.

Note: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12



# MAINTENANCE & SERVICE HISTORY

N4941A  
 S/N: 941050  
 MODEL: 3AF32C504-C/G-82NEA-5.5  
 TACH TIME:  
 HOBBS TIME: 680.7



DATE: 8/11/2021  
 W.O.#: 24338  
 TSMOH: 216.2  
 TOTAL TIME:

2980 AIRWAY AVE, COSTA MESA, CA 92626  
 TEL: 714-443-2275, WWW.JAYS AIRCRAFT.COM  
 FAA APPROVED REPAIR STATION # JAVR016L

## RIGHT PROPELLER LOG

THE AIRCRAFT AND / OR COMPONENT IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AVIATION REGULATIONS AND WAS FOUND AIRWORTHY FOR RETURN TO SERVICE. PERTINENT DETAILS OF THE REPAIR / REPLACEMENT ARE ON FILE AT THIS AGENCY

SIGNED: *[Signature]*

C/W ANNUAL INSPECTION IAW CESSNA 310R MAINTENANCE MANUAL.  
 C/W ANNUAL INSPECTION IAW MCCAULEY MAINTENANCE MANUAL.  
 SOME SBs THAT APPLY TO THIS AIRCRAFT MAY NOT HAVE BEEN PERFORMED PER OWNER'S DECISION.  
 C/W ALL APPLICABLE A.D.s THROUGHOUT THIS DATE.

--	--	--	--	--

Note: Enter Compliance With All Applicable FAA A.D. & Factory Service Bulletins On Pages 11 & 12